SAP for Spanish Valley Utah Water Watch Volunteer Monitoring Published January 1, 2015

1. Monitoring Goals and Objectives

The goal of this SAP is to document the overall monitoring plan and provide clear documentation for how Utah Water Watch (UWW) volunteers will provide assistance monitoring.

Monitoring objectives for this project are related to the UDWQ and Watershed Coordinator roles of monitoring water quality for assessment and long term data collection related to TMDLs.

Specific Objectives:

- Monitor total coliform and E. coli in streams to assess whether recreation and drinking source beneficial uses are met as part of the UDWQ's coliform monitoring program.
- Monitor temperature and total dissolved solids (TDS) to establish baseline conditions and track watershed improvement as part of the identified TMDL.

2. Background & Project Area Description

This project is taking place in the Spanish Valley surrounding Moab, UT. The two main streams are Pack and Mill Creek. The creeks start in the La Sal Mountains and flow through city of Moab before Pack Creek joins Mill Creek. Mill Creek empties directly into the Colorado River.

Name	Assessment Unit	Beneficial Uses	2010 Assessment	TMDL
Mill Creek – 1	14030005-005	1C, 2B, 3A, 4	Impaired 3A Temp;	Yes, <u>TMDL</u>
			4 TDS	
Mill Creek – 2	14030005-006	1C, 2B, 3A, 4	Not impaired; not	
			all assessed	
Pack Creek	14030005-011	1C, 2B, 3A, 4	Impaired 3A	Required;
			Selenium & Temp;	Linked in
			4 TDS	with Mill
				Creek TMDL

Impairments were initially detected in 1997 and the DWQ has developed an approved TMDL. The area has a Watershed Coordinator (WC) and a watershed group "Moab Area Watershed Partnership"

3. UWW volunteer role

The UWW volunteer will help with water quality sampling. The volunteer will serve as additional help for the watershed coordinator to monitor their many water bodies. Specifically, they will collect qualitative data about the site (water clarity, water color, number of dead fish, etc.), will measure several field parameters using calibrated field probes (temperature, TDS, pH,

etc.), and they will collect an *E. coli* sample for IDEXX testing. The volunteers will also assist the WC with the continuous monitoring (deploying, checking, and downloading the probe). The volunteer will work with the local WC to schedule times for sampling. UWW volunteer will record and enter all data in the appropriate locations. If the volunteer needs more supplies they will contact the UWW program coordinator in time to ensure delivery of supplies before the next scheduled sampling event. UWW volunteers will also share photos, stories, and potential problems with the local WC and UWW program coordinator.

4. Sampling Locations

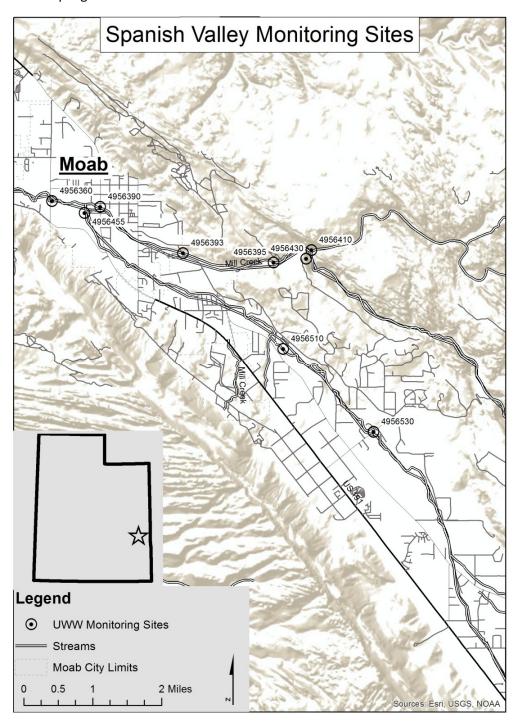


Fig. 1 Monitoring Locations – Visit the <u>UWW Map</u> for an interactive map.

DWQ Assessment Unit Name / UWW Stream Name	AWMQS Monitoring ID	UWW ID	Description	Latitude Longitude
Mill Creek -1 / Mill Creek Grand County	4956360	MICG-02-S	Mill Creek bl Confluence w Pack Ck at 500 West	38°34'19.936"N 109°33'39.422"W
Mill Creek -1 / Mill Creek Grand County	4956390	MICG-03-S	Mill Creek @ HWY 191 Xing	38°34'16.436"N 109°33'2.922"W
Mill Creek -1 / Mill Creek Grand County	4956393	MICG-04-S	Mill CK at Mill Creek Drive Xing	38°33'49.183"N 109°32'0.360"W
Mill Creek -1 / Mill Creek Grand County	4956395	MICG-05-S	Mill Creek bl Power Dam (EMAP)	38°33'40.509"N 109°31'19.604"W
Mill Creek -1 / Mill Creek Grand County	4956410	NA	North Fork Mill Creek ab cnfl Mill Creek	38°33'50.937"N 109°30'23.420"W
Mill Creek -1 / Mill Creek Grand County	4956430	NA	Mill Creek ab cnfl/ N Fk Mill Creek	38°33'45.937"N 109°30'27.420"W
Mill Creek -1 / Mill Creek Grand County	Not Available at this time	NA	Mill Creek 1 mi ab Spring Canyon	Not Available at this time
Pack Creek / Pack Creek	4956455	PACG-02-S	Pack Creek ab cnfl Mill Ck @ west end of 200 S	38°34'12.858"N 109°33'14.731"W
Pack Creek / Pack Creek	4956510	PACG-03-S	Pack Creek at Pack Creek Campground	38°32'52.740"N 109°30'44.850"W
Pack Creek / Pack Creek	4956530	PACG-04-S	Pack Creek at Spanish Trail Drive Xing	38°32'3.439"N 109°29'36.619"W

5. Sample Parameters

Qualitative Parameters: UWW Field Observations – Observed Flow, Water Surface, Water Clarity, Water Color, Water Odor, Visual Algae Cover, # of Dead Fish, Present Weather, Past 24 HR weather, Estimated Inches of Rain fall in past 72 hours, Comments

Field Parameters: Temperature, pH, Conductivity, Salinity, & TDS; Turbidity & Total Depth;

Biological Parameters: Coliforms and *E. coli*

Continuous monitoring: Hobo Temperature loggers and Pressure Transducers (Pressure Transducers also measure temperature concurrently)

DWQ Assessment Unit Name / UWW Stream Name	AWMQS Monitoring ID	UWW ID	Monitoring	
Mill Creek -1 / Mill Creek Grand County	4956360	MICG-02-S	Qualitative parameters Field Parameters Biological Parameters Continuous monitoring: Hobo Temperature	
Mill Creek -1 / Mill Creek Grand County	4956390	MICG-03-S	Qualitative parameters Field Parameters Biological Parameters Continuous monitoring: Pressure Transducer	
Mill Creek -1 / Mill Creek Grand County	4956393	MICG-04-S	Qualitative parameters Field Parameters Biological Parameters	
Mill Creek -1 / Mill Creek Grand County	4956395	MICG-05-S	Qualitative parameters Field Parameters Biological Parameters	
Mill Creek -1 / Mill Creek Grand County	4956410	NA	Continuous Monitoring: Pressure Transducer	
Mill Creek -1 / Mill Creek Grand County	4956430	NA	Continuous Monitoring: Pressure Transducer	
Mill Creek -1 / Mill Creek Grand County	Not Available at this time	NA	Continuous Monitoring: Pressure Transducer	
Pack Creek / Pack Creek	4956455	PACG-02-S	Qualitative parameters Field Parameters Biological Parameters Continuous monitoring: Pressure Transducer	
Pack Creek / Pack Creek	4956510	PACG-03-S	Qualitative parameters Field Parameters Biological Parameters	
Pack Creek / Pack Creek	4956530	PACG-04-S	Qualitative parameters Field Parameters Biological Parameters Continuous monitoring: Pressure Transducer	

6. Sampling Frequency

Parameters	Responsible Party	Frequency	Timeline
Qualitative Parameters	UWW volunteer	Once a month	December 2014 –
and Field Parameters			December 2015
Biological Parameters	UWW volunteer	Once a month May – Sept	December 2014 –
	& WC		December 2015

Continuous monitoring	WC	Collecting data every 30	Oct. 2014 – Oct. 2015
		min.	

7. Methodologies

All UWW volunteers have attended a training where they were instructed on proper techniques for sampling. Please refer to the UDWQ or UWW SOPs if additional review is needed.

The UDWQ SOPs are managed by UDWQ staff. For latest versions visit their website or contact their staff. The WC will be provided with a hard copy of the current SOPs at the time of this document's creation. The UWW SOPs are managed by USU Water Quality Extension Staff. Generally they are hosted on the UWW website and are publicly available.

UDWQ *E.coli* field sampling and processing SOPs UDWQ Pressure Transducer SOP UDWQ Temperature Logger SOP

UWW Tier II Stream SOP

- Qualitative Field Observations
- Oakton PCS 35 Testr Field Probe Calibration for conductivity and pH
- Field Probe Measurements

8. Field Equipment

Qualitative Parameters:

UWW Datasheet (Appendix)

Notebook

Pencil

Field Parameters:

Oakton PCS 35 Testr

Calibration Solutions for pH (4, 7, & 10) and conductivity (1413 μ s/cm)

60 cm Turbidity Tube

UWW Datasheet (Appendix)

Biological Parameters:

UDWQ E.coli Datasheet (Appendix)

Sterile *E.coli* sample bottles

Marker

Cooler with wet ice

Thermometer

Continuous Monitoring:

Hobo Temperature Pendent Logger
Rugged TROLL 100 Pressure Transducer
Supplies to install and secure probes in the stream
UDWQ Continuous Monitoring Data Sheet (Appendix)

9. Health & Safety

Safety is a primary concern at all times and in all sampling situations for field personal. All UWW volunteers are trained to minimize risk and sample in a safe manner. In any marginal or questionable situation, monitoring personnel (samplers) are required to assume worst case conditions and use safety precautions and equipment appropriate to that situation. Samplers who encounter conditions which in their best professional judgment may exceed the protection of their safety equipment (PFD, waders, boat, etc.) or may in any way represent a potential hazard to human health (high water levels, ice, etc.) and safety should immediately leave the area and sample at another safer time.

There should be a minimum of two sampling personnel present in the field. Samplers will wash hands and arms thoroughly with bacterial soap after sampling, before eating and drinking and at the end of the sampling run.

Before heading out to sample, samplers will inform a family member or friend when they are leaving for the field and their estimated time of return. Samplers are strongly encouraged to carry a cell phone. In case of emergency call 911.

General safety steps should be followed when on site. Wearing proper equipment (proper shoes or waders, PFD, etc.) and bringing a first aid kit is essential. Identify potential hazards (steep cliffs, barbed wire, broken glass, etc.) both on land and in the water. Follow the general standard that water flows above 1 cfs or that are deeper than knee depth can be hazardous.

10. QAQC

All UWW volunteers have attended a training where they were instructed on proper techniques for sampling. Please refer to the UTDWQ or UWW SOPs if additional review is needed.

Parameter	QC Check	Frequency	Acceptable Range	Correction Actions
E. coli	8 hour holding time; Replicates at 10 % of sites or 1 per trip if less than 10 sites. 1 Field Blank per trip	Each sampling trip	NA	Audit and train

рН	3 point meter calibration; written record of calibration	Within 24 hours prior to sampling	± 0.1	Repeat field check; if not correct return meter to manufacturer for repair
Temperature	Annual calibration against NIST thermometer	Annually	On the calibration mark	Repeat measurement with different thermometer; if not correct return meter to manufacturer for repair
Conductivity	1-point calibration; Written record of calibration	Within 24 hours prior to sampling	± 5% of standard (70 μs/cm)	Repeat field check; if not correct return meter to manufacturer for repair

Data entry QAQC – UWW volunteer double check data when they enter it on the online UWW database. The database also has internal quality control for extreme values and data entry limitations. All data submitted to the UWW database is examined by WQE staff with a QAQC checker to examine high values and data entry errors. 10% of copies of original field datasheets are submitted annually to check for data accuracy. The local watershed coordinator should also look over reports submitted on the UWW database to ensure correct data.

11. Data Documentation and Storage

Field Observations & Parameters: UWW volunteer will record all field data on the UWW Tier II datasheet. UWW volunteer will submit the electronic data online on the <u>Utah Water Watch</u>
<u>Database</u>. The original field datasheets will be stored with the local watershed coordinator who can provide copies to the UWW volunteer if needed. The WC will be provided with a filing system to store all data sheets, SOPs, and SAPs in a clearly identifiable location. The UWW program coordinator will work with the UDWQ to transfer the formatted data to UDWQ's AQWMS database.

Coliform data will be sent electronically by the WC to UDWQ for entry into the AQWMS data base. The WC will also maintain hard copies of bench sheets for three years after analysis.

Continuous temperature probe and pressure transducer data will be maintained by the WC.

12. Decontamination

All Utah Water Watch volunteers are educated about the importance of proper decontamination to prevent the spread of aquatic invasive species. This is especially important for volunteers who travel to different watersheds or lakes.

Utah Water Watch follows the Utah Division of Wildlife Resources recommended strategy of cleaning, draining, and drying all equipment. For further instructions visit the Utah Water Watch's <u>decontamination webpage</u>.

13. Participants

Name	Role	UWW	Email	Phone
		Volunteer ID		
Arne	Watershed	SE Colorado	arnehultquist@gmail.com	435-259-7558
Hultquist	Coordinator	Watershed		
		Coordinator		
Mike Allred	DWQ	N/A	mdallred@utah.gov	801-536-4331
	Scientist			
Ann Marie	BLM / UWW	13-45	aaubry@blm.gov	435-259-2173
Aubry	Volunteer			
Brian Greene	UWW	1	Brian.greene@usu.edu	435-797-2580
	program			
	coordinator			

APPENDIX

UWW Tier II Stream Data Sheet

UtahState University

WATER QUALITY EXTENSION

Certified Monitor Name(s) _		U	IWW ID #						
Site Name		U	IWW Site #						
Sample Date		ne:(HH:MM 2	4 Hour)						
Field Observations:									
Flow	1 – No flow 2 – Low 3 –	– Normal / Baseflow 4 – Hig	h / Runoff 5 – Flood						
Water Surface1 - CI	ear 2 – Scummy 3 – Foamy 4 – I	Natural debris 5 – Trash 6 – Sh	neen/Oily						
Water Clarity 1 – C	lear 2 - Cloudy/Milky	3 – Turbid							
Water Color Normal Abnormal1- Clear 2- Brownish3- Greenish4- Reddish5- Blue6- Orange									
Water Odor 1 – None 2 – Oil 3 – Sewage 4 – Rotten Egg 5 – Fishy 6 – Musky7 - Chlorine									
	e 2- Moderate substrate layer 3-	,	•						
	•	•	nentous 3- Abundant mamentous						
	Dead Fish 1 - None 2 - 1 to 3 3 - 4 to 10 4 - >10								
Present Weather	1-Clear 2 - Cloudy 3 - Ove	ercast 4 – Light Rain 5 – Hea	vy Rain 6 – Snow						
Past 24Hr Weather	1-Clear 2 - Cloudy 3 - Ove	ercast 4 – Light Rain 5 – Hea	vy Rain 6 – Snow						
Inches of rainfall ac	cumulation in past 72 Hrs								
Comments:									
IDEXX <i>E.coli</i> Sample Collec									
Compling	Leastian Side Con	tor Hobitot Diffle	n Pun Pool						
Sampling		ter Habitat Riffle	Null F00i						
Meter Calibration Log: Store Calibrated within 24 hours of sar	and calibrate standard at room templing? Yes No	perature. Date	Time						
Parameter Type	Standard Value		Post Calibration Reading						
Conductivity	1413								
pH	4.01								
pH	7.00								
рН	10.01								
Air Temperature (°C	C) Water Tem	perature (°C) pl	н						
Conductivity (µS/cn	n) TDS (ppm)	S	alinity (ppm)						
Turbidity> / = (circle one)	Turbidity T	ube (cm) Total De	epth (cm)						
Hours sampling and tra	veling Miles traveled (roundtrip)# of particip	ants Decontamination						

UDWQ E. coli Collection Field Data Sheet

Sampler(s):	
Trip Description:	

Sample Location	GPS Coordinates	Date	Time	Water Temperature (°C)	Weather	Observations (livestock or waterfowl near/in stream, recent rain, turbid water, etc.)	Photos Taken?

UDWQ Pressure Transducers Continuous Monitoring Form

									Utah DWQ, May 201:
						•	re Transducer		
				Ins	tallation, in	ispection ar	nd Maintenan		
ite Na	me:						STORET:		
							Longitud	le:	
		cer Make/M		Number					
ressur	e Transdu e Transdu	cer Factory (Calibration (Date:			Installat	ion/Denlovment	Date:
stalla	tion Perso	nnel:	canbración i					ion, ocpio, mem	
otes f	rom Insta	lation:							
		Visual	Visual	Data	Battery	Memory		Flow	
		Inspection	Inspection	Retrieval	Life	Remaining	Maintenance	Measurement	Foreign and Condition Comments
Date	Monitor Initials	Performed (Y or N)	Okay (Y or N)	Performed (Y or N)	Remaining		Performed (Y or N)	Performed (Y or N)	Equipment Condition, Comments, Describe Maintenance
		(1.21.17	(* 51.17	(1.21.17)			(1 21 11)	(1.2.1.4)	
			l .			l			